PROPELLER MAINTENANCE RECORD

		····
Propeller Mfgr. Hartzell	Hub Model HC-C2YR	- IBF
Hub Serial NoNS413B	Blade Design F7666	7-2
Blade S/N <u> </u>	Blade S/N	Blade S/N
Clamp S/N Clamp S/N	_ Clamp S/N	Clamp S/N
Blade Angles: Low 14,0 High/Feather 29.0	Start	Reverse
Deice Boot	Wire Harness	
Manufactures recommended TBO as of 03-08-2012	is <u>2400</u>	hours and/or 72 months.
Aircraft Mfgr Model	_ Registration	
Engine Mfgr.	_ Model	
Owners Name:		
Address:		

DATE	TOTAL TIME	TIME S.O.H.	DESCRIPTION OF WORK	SIGNATURE	
	12-2-15 N7184V Tac 1885.7 TSO 61.70, Propeller W/O 23617 100 hr. inspection this date. Visual inspection of prop, no deficiency found. Installed new screws in spinner. I certify that the prop has been inspected in accordance with an 100 hr. inspection, current regulations of the FAA and was determined to be in an airworthy condition. Pertinent details of the repair are on file at this repair station under workorder 23617 dated 12-2-2015				
	Jeffery A. Johnson, MF2R003L Star Aero, Inc. Higginsville, Mo. 64037				

DATE	TOTAL TIME	TIME S.O.H.	DESCRIPTION OF WORK	SIGNATURE
DATE	TIME	3.0.11.	7-10-13 N7184V Tac 1824.0 TSO 0, Propeller 100 hr. inspection this date. Visusal inspect of prop, no Prop was determined to be in an airworthy condition. under W/J# 23539 at this repair station. Randal B. Grant, MF2R003L Star Aero, Inc. Higginsv	Pretinent details
			8-12-14 N7184V Tac 1836.4 TSO 12.40, Propel 100 hr. inspection this date. Visusal inspect of prop, no Prop was determined to be in an airworthy condition. under W/O# 23553 at this repair station. Jeffery M. Johnson, MF2R003L Star Aero, Inc. Higgin	o deficency found. Pretinent details ———

		SIGNATURE
DATE	PRECISION PROPELLER SERVICE, INC. 4777 W AERONCA ST. BOISE, IDAHO U.S.A. 208-344-5161	
	Make: Hartzell Model: HC-C2YR-1BF S/N: NS413B TT: Not Given TSOH: Not Given	
	DESCRIPTION OF WORK ACCOMPLISHED Disassembled prop and cleaned all parts. Visually inspected for wear and damage. Checked seating of blade pilot bore bearings. Reassembled prop with new seals. Set angles and balance. Safety wired. PARTIAL MAINTENANCE RELEASE Only the work requested by the customer has been performed on the part or parts identified hereon. The work and/or inspection has been done in accordance with current Federal Aviation Administration Regulations and was found to be airworthy. Pertinent details of the repair are on file at this repair station under Work Order No.: 27450 Dated: 4/30/2012 Signature of authorized person	
	11-16-12 N7148V TSOH 5 Ship Tac 1823.7 Prop Removed prop for warranty. Reinstalled prop. torque and safety wire. Install spinner. Oveleb from Randal B. Grant, Star Aero, Inc. MF2R003l, Higginsville, MO. 64037	

DATE	TOTAL TIME	TIME S.O.H.	DESCRIPTION OF WORK	SIGNATURE
3.8.12			PRECISION PROPELLER SERVICE, INC. 4777 W AERONCA ST. BOISE. IDAHO U.S.A. 208-344-5161 Make: Hartzell Model: HC-C2YR-1BF S/N: NS413B TT: Hub-0- TSOH: -0- DESCRIPTION OF WORK ACCOMPLISHED Assembled propeller with factory new hub, overhauled blades and parts and new scals. Set angles, track and balance. Safety wired. Complied with S/I 152A. S/L 154, 217, 229-R2. 267, 290. 293-R1, 307. AD 2007-26-09 Blade S/N's J49137, J49138 MAINTENANCE RELEASE The work and/or inspection of the part or parts identified heron has been done in accordance with current Federal Aviation Administration Regulations and was found to be airworthy. Pertinent details of the repair are on file at this repair station under Work Order No: 27341 Dated: March 8, 2012 Signature of authorized person ALCERTIFIED REPAIR STATION NO. FG6R534N	